




Instrument Wiring Connections


Wire Color	Where To
BLK	= BLACK GROUND
TAN/WHT	= TAN/WHITE OIL LIGHT
TAN/BLK	= TAN/BLACK TEMPERATURE LIGHT
TAN	= TAN TEMPERATURE GAUGE
PUR	= PURPLE IGNITION 12 VOLT
GRY	= GRAY TACHOMETER
BRN/WHT	= BROWN/WHITE TRIM GAUGE
TAN/BLU	= TAN/BLUE VISUAL WARNING KIT (OPT)

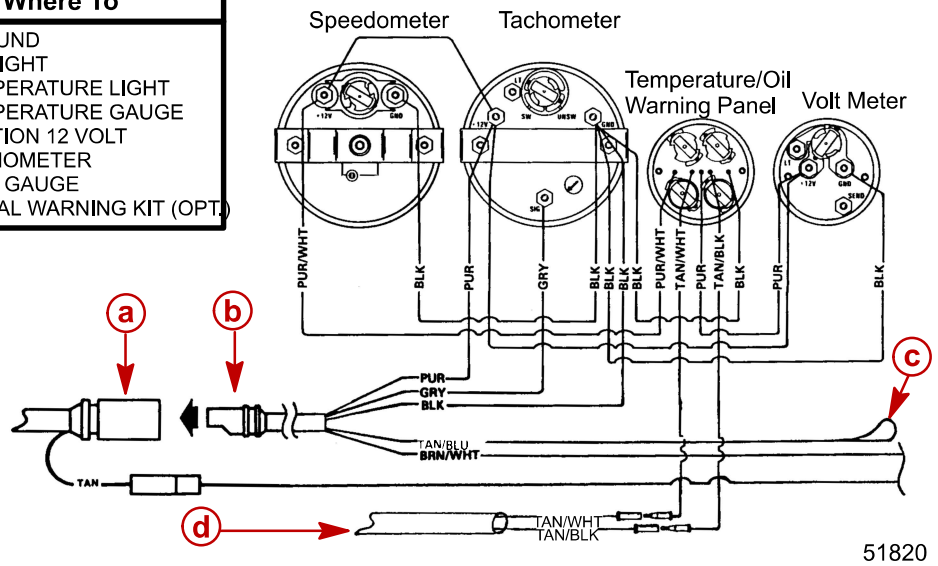

51820

Figure 1 – Without Light Switch

NOTE: ANY INSTRUMENT WIRING HARNESS LEADS NOT USED MUST BE TAPED BACK TO THE HARNESS.

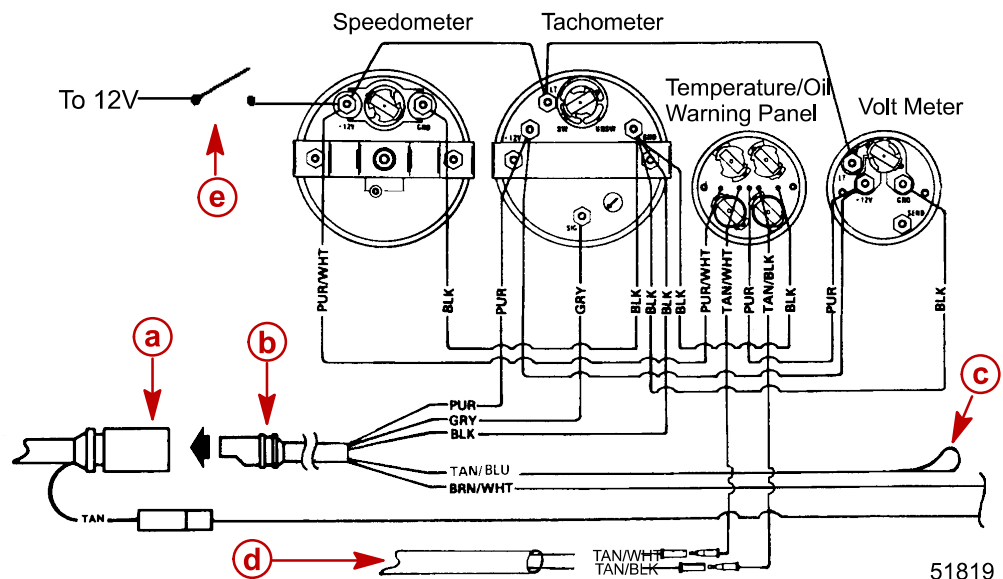

51819

Figure 2 – With Light Switch

- a** - Tachometer Receptacle - From Control Box or Ignition/Choke Switch
- b** - Tachometer Wiring Harness
- c** - Lead to Optional Visual Warning Kit (Taped Back to Harness)
- d** - Cable Extension (For Two Function Warning Panel)
- e** - Light Switch